

YEAR/MODEL ANNÉE/MODÈLE	DATE OF ISSUE DATE EN VIGUEUR	BULLETIN NUMBER NUMÉRO DU BULLETIN
1993~1995 DEL SOL	JAN. 13/1995	IV-1-95

BURNED ~OUT AUXILIARY LIGHT


Some owners of 1993~1995 Civic Del Sol's may complain of one or both auxiliary lights burning out prematurely. To correct this problem replace the bulbs in both auxiliary lights (even if only one is burned out) with the improved bulbs, listed in Parts Information.

AFFECTED UNITS: 1993~1994 Civic del Sol - Up to JHMEH6***SS800150
 1995 Civic del Sol - Up to JHMEG217*SS800086

PROCEDURE

Note: Replace both bulbs even if only one has burned out.

1. Open the hood.
2. Remove the socket from the lamp by turning it one-eighth turn counterclockwise.
3. Remove the bulb from the socket and install the new bulb.
4. Reinstall the socket in the lamp.
5. Repeat steps 2 through 5 on the other auxiliary light
6. Test the bulbs by turning on the headlights (low beam) and the auxiliary lights.

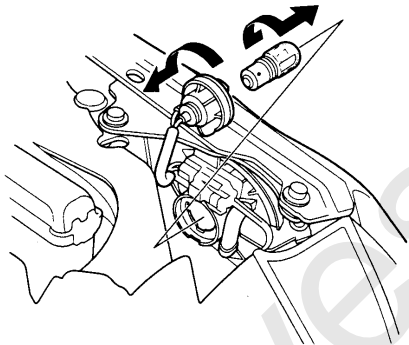

PARTS INFORMATION:

<i>Part #</i>	<i>Description</i>	<i>Quantity</i>
34903-SR2-305	Auxiliary light bulb	2

WARRANTY INFORMATION:

One year or 20,000 Km warranty policy applies. Use the information at right to complete the claim.

Def. Part No. : 34903-SF1-A01
 Def. Code : 068
 F.R.T. : 0.2
 Lbr. Oper. No. : 712107
 Contention Code : B01

Note: Repairs should only be performed as a result of a customer complaint. Preventive repairs will be subject to audit rejection.